

LEDway® and XSP Series

Direct Arm Pole Adapter Bracket

INSTALLATION INSTRUCTIONS
INSTRUCTIONS D'INSTALLATION


IMPORTANT SAFEGUARDS

When using electrical equipment, basic safety precautions should always be followed including the following:


READ AND FOLLOW ALL SAFETY INSTRUCTIONS

DANGER- Risk of shock- Disconnect power before installation.
 DANGER - Risque de choc - Couper l'alimentation avant l'installation.

SAVE THESE INSTRUCTIONS FOR FUTURE REFERENCE

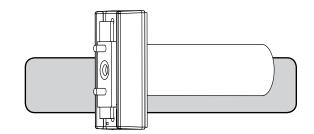

TO INSTALL:

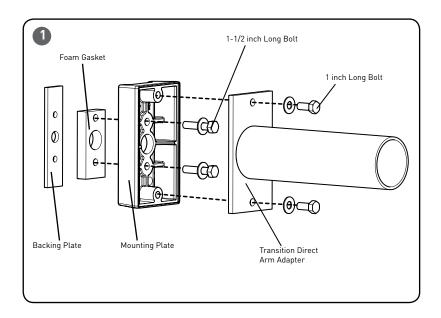

NOTE: Use dimensions on template shown on the back page for drilling if pole is not predrilled. (Template is not to scale.)

STEP 1:

Remove any extra gaskets plugs from the foam gasket and place gasket over (2) bolts extending from the Mounting Plate. See **Figure 1.**

STEP 2:

Insert Backing Plate behind mounting surface. See **Figure 1.**

STEP 3:

Secure Mounting Plate and gasket to mounting surface by tightening (2) 1-1/2 inch long bolts from Step 1 into the Backing Plate. Torque bolts to 120 in. lbs. See **Figure 1.**

STEP 4:

Attach the Transition Direct Arm Adapter to the Mounting Plate by using (2) supplied 1 inch long bolts and washers. Torque bolts to 120 in. lbs. See **Figure 1.**

STEP 5:

Attach the Transition Direct Arm assembly to luminaire by referencing the luminaire installation sheet.

